




Lynx Tech Bulletin

This bulletin applies to the new SCARPA TX Pro 2.0 and 22 Designs Lynx Bindings up through the 2023-24 model. With the release of the new TX Pro 2.0, the geometry at the front of the second heel is slightly different. This can cause the back edge of the Lynx Main Plate to catch on the front “ramp” of the boot’s second heel during a low turn.

We have modified the main plate to accommodate the new geometry and prevent this issue from occurring. If you have the SCARPA TX Pro 2.0, and need the updated main plates, they can be found [here](#). They are available for all Lynx bindings. These new main plates are shipping with the 2024-25 Lynx.


Please feel free to email us to request warranty replacements or if you have any further questions at info@twentytwodesigns.com

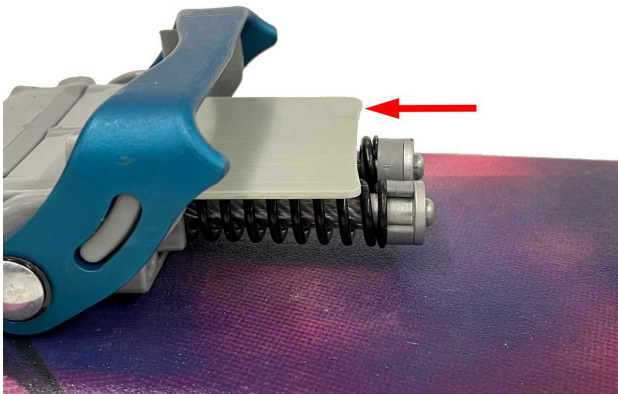

Lynx Main Plate



SCARPA TX Pro 2.0 Second Heel “Ramp”

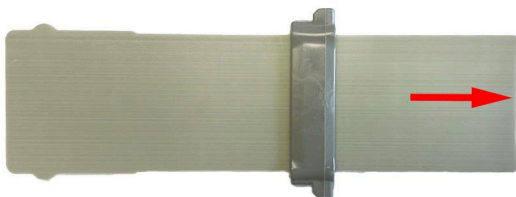

Old main plate design



New main plate design